

INSTALLATION OF KOCH BRIDGE JOINT SYSTEMS ON **BOARD OF AFFAIRS CONTRACT NUMBER 100725**

Gary G. Williams, P.E. Research Project Manager

CONSTRUCTION REPORT

Under the Supervision of C. Dwight Hixon, P.E. Research Division Engineer Research & Development Division 200 N.E. 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105

March, 1992

TG325.6 .W55 1992 OKDOT Library

16 325.6 . w56 . 1992

1.1

TECHNICAL REPORT STANDARD TITLE PAGE

1. REPORT NO. 2. GOVERNMENT ACCESSION NO. 3. RECIFIENT'S CATALOG NO. FITUR AND SUBTITLE Installation of KOCH Bridge Joint Systems on Board of Affairs Contract Number 100725. 5. REPORT DATE 7. AUTHOR(S) 6. PERFORMENC ORGANIZATION REPORT 6. PERFORMENC ORGANIZATION REPORT 7. AUTHOR(S) 0. VIELING ORGANIZATION ADDRESS 0. HERFORMENC ORGANIZATION REPORT 0. NE 21st Street, Room 2A2 0. HORK UNIT NO. 11. CONTRACT OR GRANT NO. 200 N.W. St Street, Room 37105 13. TYPE OF REPORT AND PERIOD COVERED Construction Report August, 1991 14. SPONSORING AGENCY CODE 15. SUPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENCY CODE 16. ABSTRACT OKlahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of 1-40, located in downtown Oklahoma City. The KOCH BJS Units vere installed onder a bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Smeer stalled is 80,000. It was necessary to close one traffied late at a time during installation. Smeer encoyeed for repairs, then replaced. ADT in the area where the KOCH BJS Units were ins					
Installation of KOCH Bridge Joint Systems on Board of Allairs Contract Number 100725. March, 1992 7. AUTHOR(5) 6. PERFORMING ORGANIZATION ADDRESS Oklahoma Department of Transportation Research and Development Division 200 NE 21st Street, Room 2A2 10. WORK UNIT NO. 200 NE 21st Street, Room 2A2 11. CONTRACT OR GRANIZATION CODE Oklahoma City, Oklahoma 73105 13. TYPE or REPORT NO. 12. SPONSORIE AGENEV NAME AND ADDRESS 13. TYPE or REPORT NO. Performed in cooperation with the Federal Highway Administration. 14. SPONSORIE AGENEV NAME AND ADDRESS Performed in cooperation with the Federal Highway Administration. 14. SPONSORIE AGENEV YME PRICE OF CODE 15. SUPPLEMENTARY NOTES 14. SPONSORIE AGENEV YME PRICE OF CODE Performed in cooperation with the Federal Highway Administration. 14. SPONSORIE AGENEV CODE 16. ABSTRACT Oklahoma City, CHahoma 73102 14. SPONSORIE AGENEV PRESE 17. KEY MORDS KOCH BJS units replaced other types of "water tight bridge joint devices which had failed. KOCH BJS Units were installed on an elevated portion of 1-40, located in downtown Oklahoma City, The KOCH BJS Units were installed under a bridge joint devices which had failed. KOCH Bridge Joint Systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Some congestion did re	1.		2. GOVERNMENT A	CCESSION NO.	3. RECIPIENT'S CATALOG NO.
Installation of KOCH Bridge Joint Systems on Board of Allairs Contract Number 100725. March, 1992 7. AUTHOR(5) 6. PERFORMING ORGANIZATION ADDRESS Oklahoma Department of Transportation Research and Development Division 200 NE 21st Street, Room 2A2 10. WORK UNIT NO. 200 NE 21st Street, Room 2A2 11. CONTRACT OR GRANIZATION CODE Oklahoma City, Oklahoma 73105 13. TYPE or REPORT NO. 12. SPONSORIE AGENEV NAME AND ADDRESS 13. TYPE or REPORT NO. Performed in cooperation with the Federal Highway Administration. 14. SPONSORIE AGENEV NAME AND ADDRESS Performed in cooperation with the Federal Highway Administration. 14. SPONSORIE AGENEV YME PRICE OF CODE 15. SUPPLEMENTARY NOTES 14. SPONSORIE AGENEV YME PRICE OF CODE Performed in cooperation with the Federal Highway Administration. 14. SPONSORIE AGENEV CODE 16. ABSTRACT Oklahoma City, CHahoma 73102 14. SPONSORIE AGENEV PRESE 17. KEY MORDS KOCH BJS units replaced other types of "water tight bridge joint devices which had failed. KOCH BJS Units were installed on an elevated portion of 1-40, located in downtown Oklahoma City, The KOCH BJS Units were installed under a bridge joint devices which had failed. KOCH Bridge Joint Systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Some congestion did re	4.	TITLE AND SUBTITLE			5. REPORT DATE
Affairs Contract Number 100725. 6. PERFORMING ORGANIZATION CODE 7. AUTHOR(5) Gary G. Williams 6. PERFORMING ORGANIZATION ADDRESS Oklahoma Department of Transportation Research and Development Division 200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 10. MORK UNIT NO. 12. SPUNGDRING AGENCY AME AND ADDRESS Federal Highway Administration 200 N. Sth Street, Room 454 Oklahoma City, Oklahoma 73102 11. CONTRACT OR GRANT AND PERIOD COVERED Construction Report August, 1991 13. SUPPLEMENTARY MOTES Performed in cooperation with the Federal Highway Administration. 14. SPONGORING AGENCY CODE 14. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of 1-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used port 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units carry a two-year warranty covering materials and installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 12. KEY WORDS Water Tight Bridge Joint Systems. 14. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Okl	1 ···	Installation of KOCH Bridge Joint Systems on Board of			
7. AUTHOR(S) Gary G. Williams 8. PERFORMING ORGANIZATION ADDRESS Oklahoma Department of Transportation Research and Development Division 200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 10. WORK UNIT NO. 12. SPONSORING AGENCY NAME AND ADDRESS Performed in cooperation with the Federal Highway Administration 200 N.W. 5th Street, Room 454 Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 13. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units screenter as a sinalled under a bri					
Gary G. Williams 10. MORK UNIT NO. • PERFORMING ORGANIZATION ADDRESS Oklahoma Development Division 200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 11. CONTRACT OR GRANT NO. 12. SPONGORING AGENCY ANDRESS Pederal Highway Administration 200 N.W. 5th Street, Room 454 Oklahoma City, Oklahoma 73102 13. TYPE OF REPORT AND PERIOD COVERED Construction Report August, 1991 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENCY ANDRESS Performed in cooperation with the Federal Highway Administration. 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which MCCH BJS Units carry a two-year warranty covering materials and installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Re					6. PERFORMING ORGANIZATION CODE
Gary G. Williams 10. MORK UNIT NO. • PERFORMING ORGANIZATION ADDRESS Oklahoma Development Division 200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 11. CONTRACT OR GRANT NO. 12. SPONGORING AGENCY ANDRESS Pederal Highway Administration 200 N.W. 5th Street, Room 454 Oklahoma City, Oklahoma 73102 13. TYPE OF REPORT AND PERIOD COVERED Construction Report August, 1991 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENCY ANDRESS Performed in cooperation with the Federal Highway Administration. 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which MCCH BJS Units carry a two-year warranty covering materials and installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Re	7.	AUTHOR(S)			8. PERFORMING ORGANIZATION REPORT
9. PERFORMING ORGANIZATION ADDRESS Oklahoma Department of Transportation Research and Development Division 200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 11. CONTRACT OR GRANT NO. 12. SPONSORING AGENCY NAME AND ADDRESS Federal Highway Administration 200 N.W. 5th Street, Room 454 Oklahoma City, Oklahoma 73102 13. TYPE OF REPORT AND PERIOD COVERED Construction Report August, 1991 13. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENCY CODE 14. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of 1-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJ Luits with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 14. NETREMONS Wat	· · ·				
 P. PERFORMING ORGANIZATION ADDRESS OKIAhOMA Department of Transportation Research and Development Division 200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 SPONGORING AGENCY NAME AND ADDRESS Federal Highway Administration 200 NV. Sth Street, Room 454 Oklahoma City, Oklahoma 73102 SPONGORING AGENCY NAME AND ADDRESS Federal Highway Administration 200 NV. Sth Street, Room 454 Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the US. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units car be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 14. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 		Gary G. Winnams			
Oklahoma Department of Transportation Research and Development Division 200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 11. CONTRACT OR GRANT NO. 12. SPONSORIME AGENEY NME AND ADDRESS Federal Highway Administration 200 N.W. 5th Street, Room 454 Oklahoma City, Oklahoma 73102 13. TYPE OF REPORT AND PERIOD COVERED Construction Report August, 1991 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENEY NOTES 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carb erepaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 14. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 1				1	0. WORK UNIT NO.
Research and Development Division 200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 13. TYPE OF REPORT AND PERIOD COVERED Construction Report August, 1991 12. sryPLEMENTARY NOTES Federal Highway Administration 200 N.W. Sth Street, Room 454 Oklahoma City, Oklahoma 73102 14. SPONSORING AGENCY CODE 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENCY CODE 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units car be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY MORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictio	9.	PERFORMING ORGANIZATION ADDR	ESS		
Research and Development Division 200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 13. TYPE OF REPORT AND PERIOD COVERED Construction Report August, 1991 12. srynsorRime AcEncy NAME AND ADDRESS Federal Highway Administration 200 N.W. Sth Street, Room 454 Oklahoma City, Oklahoma 73102 14. SPONSORING AGENCY CODE 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENCY CODE 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units vere installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units car be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY MORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEME		Oklahoma Department of 7	ransportation	-	
200 NE 21st Street, Room 2A2 Oklahoma City, Oklahoma 73105 13. TYPE OF REPORT AND PERIOD COVERED Construction Report August, 1991 12. SPONSORING AGENCY NAME AND ADDRESS Federal Highway Administration 200 N.W. Sth Street, Room 454 Oklahoma City, Oklahoma 73102 14. SPONSORING AGENCY CODE 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENCY CODE 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units car be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publicatio					I. CUNIKACI UK GRANI NU.
Oklahoma City, Oklahoma 73105 13. WH OR REPORT AND FERIOD COVERED 12. SPONSORIME AGENEY NAME AND ADDRESS Federal Highway Administration 200 N.W. 5th Street, Room 454 Oklahoma City, Oklahoma 73102 14. SPONSORING AGENEY CODE 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENEY CODE 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which Must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 16. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS RE					
12. SPONSORING AGENCY NAME AND ADDRESS Federal Highway Administration 200 N.W. Sth Street, Room 454 Oklahoma City, Oklahoma 73102 Construction Report August, 1991 13. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 14. SPONSORING AGENCY CODE 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 16. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19. SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REP				1	3. TYPE OF REPORT AND PERIOD COVERED
12. STONSORING AGENCY WATE AND ADDRESS Federal Highway Administration 200 N.W. 5th Street, Room 454 Oklahoma City, Oklahoma 73102 August, 1991 14. SPONSORING AGENCY CODE 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY MORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19. SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CL					Construction Report
14. SPONSORING AGENCY CODE 200 N.W. Sth Street, Room 454 Oklahoma City, Oklahoma 73102 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of 1-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carp a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. 14. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Ok	12.				
Oklahoma City, Oklahoma 73102 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REPORT)		Federal Highway Administr	ation		
Oklahoma City, Oklahoma 73102 15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at ime during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS REPORT)		200 N.W. 5th Street, Room	454	14	4. SPONSORING AGENCY CODE
15. SUPPLEMENTARY NOTES Performed in cooperation with the Federal Highway Administration. 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19. SECURITY CLASSIF. (0F THIS REPORT) 20. SECURITY CLASSIF. (0F THIS REPORT) 21. NO. OF PAGES 22. PRICE					
Performed in cooperation with the Federal Highway Administration. 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (0F THIS REPORT) 20.SECURITY CLASSIF. (0F THIS REPORT) 21.NO. OF PAGES 22.PRICE		o manoma ony, o manoma			x
Performed in cooperation with the Federal Highway Administration. 16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (0F THIS REPORT) 20.SECURITY CLASSIF. (0F THIS REPORT) 21.NO. OF PAGES 22.PRICE			and the second second		
16. ABSTRACT Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY MORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. U9.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE	15.		the the Dedevel		
Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE		Performed in cooperation w	ith the Federal	Highway Administ	ration.
Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
Oklahoma Department of Transportation (ODOT) Maintenance and Bridge Engineers have been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units carry a two-year warranty advantage over many bridge joint systems, which must be removed for repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE	16.	ABSTRACT			
been looking for a satisfactory water tight bridge joint device or system for many years. 27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE			Transportation	(ODOT) Maintan	ance and Bridge Engineers have
27 KOCH Bridge Joint Systems (KOCH BJS) have been installed on an elevated portion of I-40, located in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19. SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
Iocated in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 0klahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE		been looking for a satisfacto	bry water tight t	oridge joint device	or system for many years.
Iocated in downtown Oklahoma City. The KOCH BJS Units were installed under a bridge joint repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 0klahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 0Klahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REPORT) 21.NO. OF PAGES 22.PRICE					
repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 0Klahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REPORT) 21.NO. OF PAGES 22.PRICE					
which had failed. KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS PAGE) 21.NO. OF PAGES 22.PRICE		repair project. All KOCH BJS units replaced other types of "water tight" bridge joint devices			
KOCH Bridge Joint systems are a proprietary product which has been used for 18 years in Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 21.NO. OF PAGES 22.PRICE					
Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS REPORT)		which had falled.			
Europe, but is still relatively unknown in the U.S. KOCH BJS Units carry a two-year warranty covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS PAGE) 21.NO. OF PAGES 22.PRICE		VOCH Bridge Joint eventeene and a mennistery medicat which has been used for 10			
covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS REPORT) 21.NO. OF PAGES 22.PRICE		Funder bill relatively under a proprietary product which has been used for 18 years in			
 with modified asphalt. The ease with which KOCH BJS Units can be repaired give them an advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT					
advantage over many bridge joint systems, which must be removed for repairs, then replaced. ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS PAGE) 21.NO. OF PAGES 22.PRICE		covering materials and installation. Repairs usually consist of overlaying the KOCH BJS Units			
ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE		with modified asphalt. The	ease with which	h KOCH BJS Un	its can be repaired give them an
ADT in the area where the KOCH BJS Units were installed is 80,000. It was necessary to close one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS PAGE) 21.NO. OF PAGES 22.PRICE		advantage over many bridge	ioint systems.	which must be rem	oved for repairs, then replaced.
one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS REPORT)		5 , 6	, , , , , , , , , , , , , , , , , , , ,		1 , 1
one traffic lane at a time during installation. Some congestion did result from the lane closings, otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS REPORT)		ADT in the area where the	KOCH BIS Uni	s were installed is	80,000. It was necessary to close
otherwise the units were installed with a minimum of interruption to motorists. 17. KEY WORDS Water Tight Bridge Joint Systems. 18. DISTRIBUTION STATEMENT No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS REPORT)		one traffic lane at a time du	ring installation	Some congestion	did result from the lane closings
17. KEY WORDS 18. DISTRIBUTION STATEMENT Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE		otherwise the units were installed with a minimum of interruption to motorists.			
Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					÷
Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
Water Tight Bridge Joint Systems. No restrictions. This publication is available from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
from the Research and Development Division, Oklahoma DOT. 19.SECURITY CLASSIF. (OF THIS REPORT) 20.SECURITY CLASSIF. (OF THIS PAGE) 21.NO. OF PAGES 22.PRICE		Water Tight Bridge Joint Sy	stems.	No restriction	ns. This publication is available
Oklahoma DOT. 19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE					
19.SECURITY CLASSIF.(OF THIS REPORT) 20.SECURITY CLASSIF.(OF THIS PAGE) 21.NO. OF PAGES 22.PRICE				Oklahoma Do	OT.
				Okianonia De	· · ·
	19.S	ECURITY CLASSIF. (OF THIS REPO	RT) 20.SECURITY	CLASSIF. (OF THIS PA	AGE) 21.NO. OF PAGES 22.PRICE
				and the set of the set	
		Chelasshied	Unciassi.	100	2.5

The contents of this report reflect the views of the authors who are responsible for the facts and the accuracy of the data presented herein. The contents do not necessarily reflect the official views of the Oklahoma Department of Transportation or the Federal Highway Administration. This report does not constitute a standard, specification, or regulation. While contractor names are used in this report, it is not intended as an endorsement of any machine, contractor, or product.

Table of Contents

NTRODUCTION	. 1
ESCRIPTION	5
Backer Rod	
Bridge Plate	6
KOCH BRIDGE JOINT BINDER	6
Aggregate	6
NSTALLATION	8
Joint Preparation	
Backer Rod	
Bridge Plate	
Modified Asphalt Concrete	
NSTALLATION COSTS	17
IONITORING AND REPORTING	18
ppendix A. Specification for Installation of The KOCH BJS Bridge Joint	19

List of Illustrations

Figure	1.	KOCH BJS Locations 2
Figure	2.	Completed KOCH BRIDGE JOINT SYSTEM 5
Figure	3.	Bags of Granite Chip Aggregate 7
Figure	4.	Bridge Joint Prepared for KOCH BJS Installation
Figure	5.	Heating Exposed Saw Cut, Expansion Gap, and Bridge Deck 9
Figure	6.	Kettle and Blocks of BJB Before Heating 10
Figure	7.	Placing Backer Rod in Expansion Gap 11
Figure	8.	Placing Bridge Plate Over Sealed Expansion Gap 12
Figure	9.	Smoothing Surface of BJB Over Bridge Plate 12
Figure	10.	Mixing BJB and Granite Aggregate in 1/2 C.Y. Mixers 14
Figure	11.	Checking AC Mix Temperature with Digital Thermometer 14
Figure	12.	Placing 3/4 Inch Modified AC Mix 15
Figure	13.	Compacting Modified AC with Two Ton Roller
Figure	14.	Completed KOCH BJS Unit 16

List of Tables

Table	1.	KOCH BJS Unit Locations.	3
Table	2.	Joint Lengths and Installation Dates.	4

INTRODUCTION

The Oklahoma Department of Transportation (ODOT) has installed KOCH BRIDGE JOINT SYSTEMS (KOCH BJS) on twenty seven (27) expansion joints on I-40 in downtown Oklahoma City. The KOCH BJS units were installed on a two mile long, elevated section of I-40, and all replaced other types of watertight bridge joint devices which had failed. Twenty three (23) of the joints where the KOCH BJS systems were installed were located on the main line of the eastbound I-40 expressway and four were located on elevated entrance and exit ramps.

KOCH BJS locations are shown in Figure 1, and are listed in Table 1. Locations are numbered in west-to-east order, and are described by street location for convenience in locating any failures which may occur. Joint lengths varied with lane requirements at each location. Lengths of joints where the KOCH BJS Units were installed are listed in Table 2.

The KOCH BJS was originally known as The PAVETECH Bridge Joint System (PAVETECH BJS). The PAVETECH BJS was invented in England, and has been used in Europe for 18 years. In 1991, Koch Materials Company, of Stroud, Oklahoma, purchased the U.S. rights to the PAVETECH BJS and changed it's name to The KOCH BJS.

The KOCH BJS is a proprietary product. Installed KOCH BJS systems carry a 24 month warranty covering materials and installation. However, installation must be done by a KOCH Materials Company licensee or the warranty will not be given.

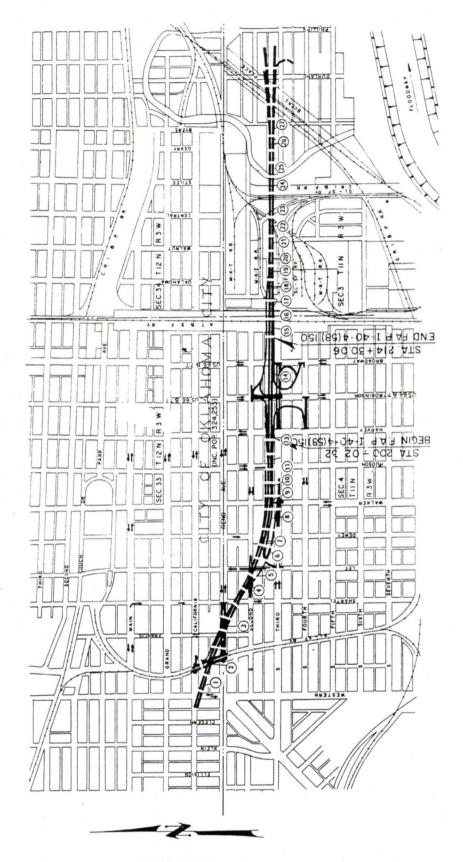


Figure 1. KOCH BJS Locations.

Table 1. KOCH BJS Unit Locations.

Unit Number and Location.

- 1. 200 feet east of Western Avenue Overpass.
- 2. 150 feet east of Classen Avenue Overpass.
- 3. 120 feet east of Francis Avenue Overpass.
- 4. 300 feet west of Lee Street Overpass.
- 5. 200 feet west of Lee Street Overpass.
- 6. Above west abutment, Walker Street Exit Ramp.
- 7. East end of Walker Street Exit Ramp.
- 8. Above west abutment, Lee Street Entrance Ramp.
- 9. East end of Lee Street Entrance Ramp.
- 10. 100 feet east of Lee Street Entrance.
- 11. 200 feet east of Lee Street Entrance.
- 12. 150 feet east of Hudson Street Overpass.
- 13. 100 feet west of Harvey Street Overpass.
- 14. 100 feet west of Broadway Avenue Overpass.
- 15. 100 feet east of Broadway Street Overpass.
- 16. 175 feet east of Broadway Avenue Overpass.
- 17. 300 feet east of Broadway Avenue Overpass.
- 18. 500 feet east of Broadway Avenue Overpass.
- 19. 650 feet east of Broadway Avenue Overpass.
- 20. 800 feet east of Broadway Avenue Overpass.
- 21. 1,000 feet east of Broadway Avenue Overpass.
- 22. 1,150 feet east of Broadway Avenue Overpass.
- 23. 1,250 feet east of Broadway Avenue Overpass.
- 24. 1,500 feet east of Broadway Avenue Overpass.
- 25. 1,700 feet east of Broadway Avenue Overpass.
- 26. 700 feet west of Lincoln Avenue Exit.
- 27. 500 feet west of Lincoln Avenue Exit.

Table 2.	oome Dengens and m	stunution Dutes.
BJS Unit	Joint Length	Date Installed
	(feet)	
1.	37.25	08-07-91
2.	37.16	08-07-91
3.	37.16	08-07-91
4.	37.33	08-07-91
5.	37.00	08-08-91
6.	18.00	08-15-91
7.	18.00	08-15-91
8.	18.00	08-15-91
9.	18.00	08-15-91
10.	37.00	08-08-91
11.	38.00	08-08-91
12.	50.00	08-09-91
13.	37.00	08-09-91
14.	49.00	08-09-91
15.	49.50	08-09-91
16.	47.25	08-12-91
17.	37.00	08-12-91
18.	37.08	08-12-91
19.	37.16	08-12-91
20.	37.00	08-13-91
21.	37.25	08-13-91
22.	37.00	08-13-91
23.	37.08	08-13-91
24.	37.16	08-13-91
25.	37.16	08-14-91
26.	37.00	08-14-91
27.	64.50	08-15-91

Table 2. Joint Lengths and Installation Dates.

DESCRIPTION

The KOCH BJS (Figure 2) consists of an asphaltic plug, a bridge plate, and a specific modified asphalt concrete. A strip of backer rod is used during installation. Specifications recommended by Koch Materials Company, covering all BJS components, are attached (Appendix A). System Components are described individually, in additional detail in the following paragraphs.

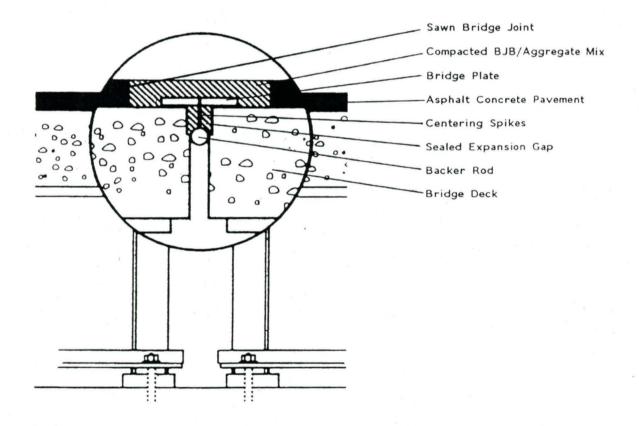


Figure 2. Completed KOCH BRIDGE JOINT SYSTEM.

Backer Rod

The backer rod used with The KOCH BJS is a closed cell, foam joint filler. The backer rod is compressed into the joint before the other components of the system are installed. Backer rod provides support for the rest of the system during installation, rather than functioning as part of the completed system.

Bridge Plate

The BJS bridge plate is an eight inch wide, one quarter inch thick, mild steel plate. Holes are drilled along the center of the plate at one foot intervals. Centering spikes are inserted in the holes during installation. The bridge plate covers the joint opening (expansion gap) to prevent the matrix of the BJS from entering the gap.

KOCH BRIDGE JOINT BINDER

KOCH BRIDGE JOINT BINDER (KOCH BJB) is a thermoplastic, polymeric, modified asphalt binder. KOCH BJB is used as a coating material for all faces of the joint trench. It is also used as a sealer for the expansion joint gap above the backer rod, and as a modified asphalt binder for the material in the joint. KOCH BJB is delivered to the jobsite in 50 pound blocks, (Figure 5), which must be melted in an oil jacketed kettle before application.

Aggregate

A specific granite chip aggregate is used in the modified asphalt cement of the KOCH BJS. Only two U.S. quarries have been approved as aggregate sources at this time. For applications in the western U.S., including Oklahoma, the aggregate comes from San Saba, Texas. A North Carolina quarry supplies the Eastern U.S. Koch Materials Company requires that aggregate withstand heating to 400 degrees F., and that it pass company tests designed to show that it is resistant to stripping. Aggregate is shipped to Koch Materials Company licensees in 50 pound bags (Figure 3).

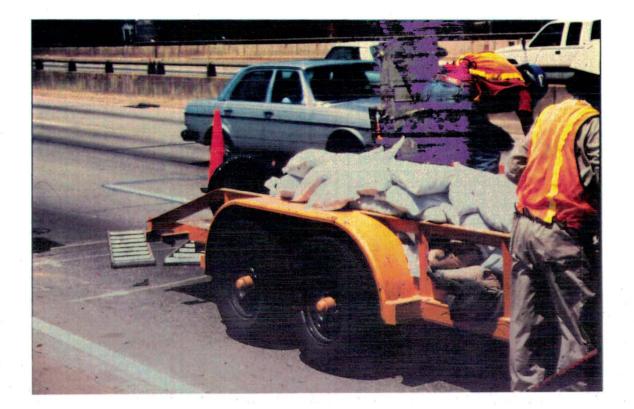


Figure 3. Bags of Granite Chip Aggregate.

INSTALLATION

Koch Materials Company Specifications for BJS System installation are listed in Appendix A. To insure that these specifications are followed, the 24 month warranty is given only if installation is done by company-licensed applicators. The licensee for the area covering Oklahoma is Alpha Pavement Technology Incorporated, of Amarillo, Texas. On this project, all KOCH BJS units were installed on retrofit locations. The BJS units installed here replaced other types of watertight bridge joint devices which had failed.

Work began at 10:00 AM, July 23, 1991. Installation of twenty five (25) units was completed by 3:00 PM, August 2, 1991. The remaining two (2) units were installed August 14 and 15. All installations were completed by 3:00 PM, August 15. Installation was done, one lane at a time, with the remaining lane open to traffic. The Installation operation was then moved to the other lane while traffic used the lane where installation was complete. The installation operation is described below, by component or operation, in the order the operations are carried out.

Joint Preparation

The bridge deck surface where a BJS System will be installed is prepared as follows: A saw cut is made on each side of the expansion joint. The saw cuts run across the width of the bridge (Figure 4). Recommended distance between the two cuts is twenty inches. Cut depth varies with the amount of asphalt concrete that must be sawn through to reach the PCC bridge deck. On this project, the cut depth was approximately three inches. All material between the two saw cuts is then removed. The faces of the saw cuts and the expansion joint are cleaned with a hand-held electric grinder, as is the bridge deck surface between the cuts. The exposed faces of the saw cut, expansion gap, and bridge deck are then heated with a heat lance (Figure 5.) to remove any moisture which may be present.

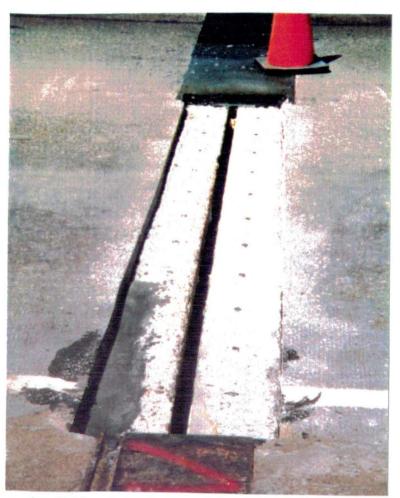


Figure 4. Bridge Joint Prepared for KOCH BJS Installation.

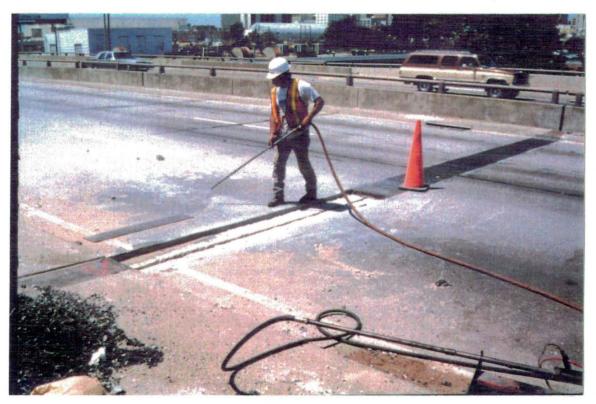


Figure 5. Heating Exposed Saw Cut, Expansion Gap, and Bridge Deck.

Backer Rod

The backer rod is cut from two and one half inch thick sheets of closed cell foam expansion joint filler. Width of backer rod cut for each joint varies so that backer rod width is sufficient to form a tight seal in the expansion gap. Backer rod is then forced into the expansion gap to a minimum depth of one inch (by specification). On this project, backer rod was forced approximately two inches into the expansion gap. When in the expansion gap, the backer rod forms a seal such that Koch BJB can be poured over it, forming an asphaltic plug. Positioning the backer rod deeper in the expansion gap means that the gap will be sealed to a greater depth.

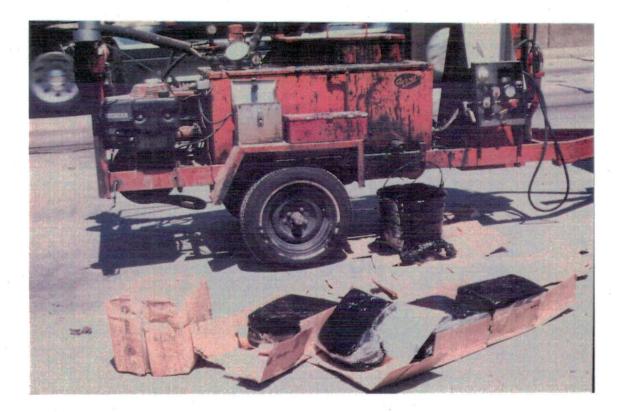


Figure 6. Kettle and Blocks of BJB Before Heating.

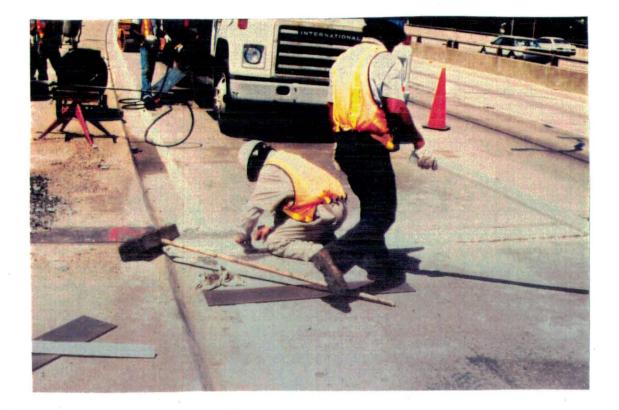


Figure 7. Placing Backer Rod in Expansion Gap.

Bridge Plate

Before the bridge plate is installed, a seal is formed by pouring Koch BJB over the expansion gap and backer rod. After this has been done, the bridge plate is laid over the expansion gap (Figure 8) to insure plate lengths are correct before permanent installation. Koch BJB is then poured over the face of the saw cut, and the sealed expansion gap. Centering spikes are placed into holes in the plate, and the plate is placed in its permanent location. Just before each section of plate is put in place, more BJB is poured over the expansion gap and deck. This is done to further insure a good seal. When all pieces of bridge plate are in place, BJB is poured over them and the surface of the BJB is smoothed by hand (Figure 9). By this time, there is a continuous coating of BJB from the top of the backer rod to the top of the bridge plate.

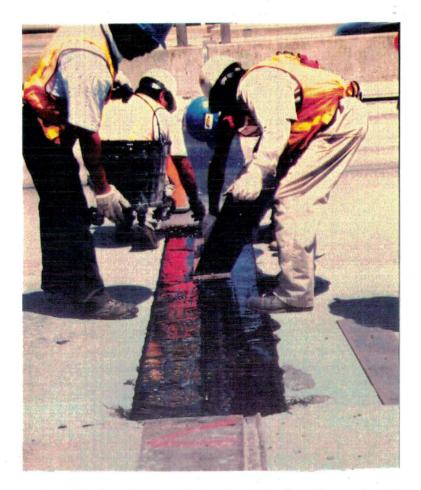


Figure 8. Placing Bridge Plate Over Sealed Expansion Gap.



Figure 9. Smoothing Surface of BJB Over Bridge Plate. keys

INSTALLATION

Modified Asphalt Concrete

After the bridge plate has been installed and sealed, modified asphalt concrete is laid over it. The modified AC consists of KOCH BJB binder and granite chip aggregate. Gradations for the two mix designs used (3/4 inch and 1/2 inch chip size) are given in Appendix A. The first lift of modified AC is 3/4 inch chip mix. Before laying, the KOCH BJB/granite chip mix was heated to 300 degrees F. while mixing in 1/2 cubic yard mixers (Figure 10). Mix temperature is checked with a hand-held, digital thermometer (Figure 11). The granite aggregate must be totally precoated during mixing or the mix will be considered unusable. Coating of aggregate was checked visually.

If the depth of cut is sufficient, two lifts of the 3/4 inch mix are laid. On this project, only one lift, two inches thick, was laid. A lift of 1/2 inch chip mix was laid over the 3/4 inch lift, bringing the surface of the BJS to approximately 1/2 inch above the existing pavement. The entire joint was then compacted with a two ton roller. (Figure 13). After compaction, the joint surface was flush with the existing pavement. The surface of the sealed joint was then heated to a tack consistency with a heat lance, and a thin membrane of BJB was poured over the joint.

A layer of sandblast sand was applied over the BJB membrane. Sand was applied over the membrane by pouring it beside the sealed joint and pushing it onto the membrane with a hand-operated broom .

On this project, traffic was kept off the lane where the BJS Systems were applied until the last BJS done during the days run had been completed for at least one and one half hours. Company literature indicates that lanes can be opened to traffic 15 minutes after installation is complete. A completed KOCH BJS is shown in Figure 14.



Figure 10. Mixing BJB and Granite Aggregate in 1/2 C.Y. Mixers.

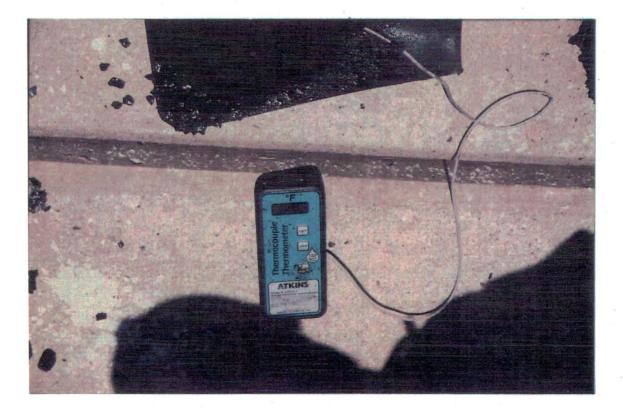


Figure 11. Checking AC Mix Temperature with Digital Thermometer.



Figure 12. Placing 3/4 Inch Modified AC Mix.



Figure 13. Compacting Modified AC with Two Ton Roller

INSTALLATION

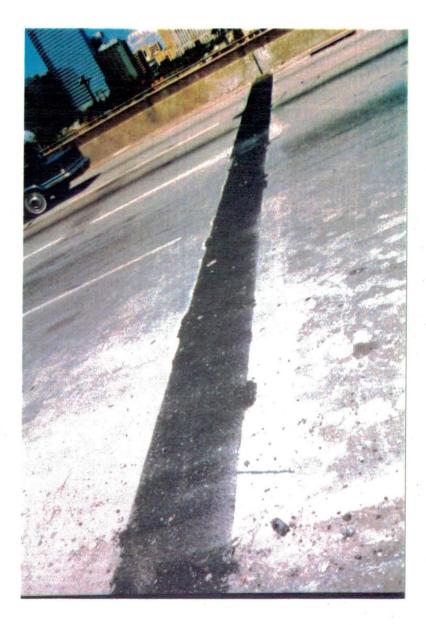


Figure 14. Completed KOCH BJS Unit.

INSTALLATION COSTS

A total of 27 expansion joints were retrofitted with Koch BJS devices on this contract. The total contract cost of replacing the failed systems with Koch BJS devices was \$153,384.00. This was the bid price to replace 996 L.F. of expansion joint devices at \$154.00 per L.F. As previously mentioned, a two year warranty covering materials and installation is included. The warranty will cover the direct cost of repairs, if any are required. In most cases, repair of KOCH BJS units consists of overlaying them with additional modified asphalt concrete. Repairs under warranty are done by Koch Materials Company Licensees. It is beyond the scope of this construction report to estimate indirect costs which may be involved in repair. However, it should be noted that even if repair of the devices is done under warranty, ODOT will still be providing traffic control, and user costs due to delays to motorists will increase if repairs are required.

Traffic control on this project involved four men and the following equipment: One dump truck, one 1/2 ton pickup, two arrow boards, approximately 60 channelization cones, and six signs.

ADT here is 80,000. Work was done one lane at a time, with the remaining lane open to traffic. Work crews were required to start after the morning rush hour, and be off the road before the evening rush hour began. Although this requirement kept congestion below what it might have been, each car travelling through the project area was delayed approximately six minutes when construction was in progress. The delay was approximated by measuring the time it took to drive through the construction zone during construction and comparing this to a time measurement made after construction was completed.

MONITORING AND REPORTING

Monitoring will include visual surveys of all 27 Koch BJS units. Surveys will be done twice a year. Both the bridge deck surfaces and the joints below the bridge will be inspected. Any failures reported or observed during the surveys will be reported. If failures are reported at times when surveys are not scheduled, a survey will be scheduled as soon as possible. Reporting will be in letter-to the-file form unless substantial failure occurs. In that case, a "Final Report" covering the failures, and performance before failure, will be written. Surveys will continue for three years if no failures occur. At that time, a recommendation will be made on whether or not observation should be continued. If the ODOT Bridge Division decides the devices have performed well enough to be accepted, a "Final Report", will be written at that time. The "Final Report" will summarize performance to date, and will indicate that the Koch BJS has been accepted.

Appendix A. Specification for Installation of The KOCH BJS Bridge Joint System

IAKOCH

KOCH MATERIALS COMPANY

COATINGS & SEALANTS DIVISION

SPECIFICATION FOR INSTALLATION OF THE KOCH BJS BRIDGE JOINT SYSTEM

SCOPE

This work shall consist of supplying and installing a binder and aggregate system composed of specially blended, polymer modified asphalt and specific aggregate placed into a prepared expansion joint blockout. The correct material and installation will provide a flexible waterproof bridge joint which will allow for all joint movement up to 2".

MATERIAL

The bridge joint binder (BJB) shall be a thermoplastic polymeric modified asphalt, as manufactured by Koch Materials Company, and shall meet the following requirements when tested according to ASTM test methods:

	Test Method	Typical Values	
Softening Point	ASTM D-36	180° F (82° C) Min.	
Tensile Adhesion	ASTM D-3583	.800% Min.	
Ductility @ 77° F (25° C)	ASTM D-113	40 cm. Min.	
Penetration	ASTM D-3407		
	77° F (25° C) 150g, 5 sec	.90 dmm Max.	
	0° F (-18° C) 200g, 60 sec	.10 dmm Min.	
Flow 5 h @ 140° F (60° C)	ASTM D 3407	.3.0 mm Max.	
Resiliency @ 77° F (25° C)	ASTM D 3407	.60% Min.	
Asphalt Compatibility	ASTM D-3407	. Pass	
Recommended Pouring Temperature			
Safe Heating Temperature		.410° F (199° C)	

The specified aggregate shall be a crushed, doublewashed, and dried granite. It will be supplied in both 3/4" and 1/2" sizes which meet the following requirements:

Gradations:	Sieve Size	3/4" Size % Passing	1/2" Size % Passing
	7/8	95-100	-
	5/8	30-50	100
	1/2	10-25	90-100
	3/8	0-10	40-70
	#4	-	10-20
	#8	-	0-10

The backer rod shall be a closed cell, foam expansion joint filler, capable of withstanding the elevated temperature of the polymeric binder. The backer rod shall have the following typical physical properties using a 1/2" specimen and test method ASTM D-545.

Compression, 50%	13.3 psi
Extrusion	0.1 inch
Recovery	99.21% Min.
Water Absorption, Volume %	0.246 Max.

The bridging plate shall be a mild steel plate, 1/4" thick by 8" wide, cut in 4 foot lengths. Spike holes shall be drilled, on a longitudinal centerline, at 1 foot intervals.

CONSTRUCTION PROCEDURES

The BJS System installation shall be centered over the existing expansion joint gap to the recommended width of 20 inches. Variations in the width of the joint will be determined by the site engineer and the manufacturer.

Remove all material between the saw cut, including the wearing surface, riser bars, and any old expansion joint material. This will form the bridge joint blockout. Damaged concrete on the joint table must be removed. The previous expansion joint system must be removed to a depth which will allow the BJS joint system to be installed.

The joint blockout area is prepared by cleaning and drying the blockout area, and 6 inches on either side of the joint. To accomplish this, use a hot compressed air lance capable of producting 3000° F and a directional velocity of 3000 fps.

SPECIFICATION FOR INSTALLATION OF THE KOCH BJS BRIDGE JOINT SYSTEM

(Continued)

CONSTRUCTION PROCEDURES (Continued)

Heat the bridge joint binder to a minimum of 350° F in a double oil jacketed melter. The melter must be equipped with a continuous agitation system, temperature controls, and calibrated thermometers to maintain the BJB binder at the manufacturers recommended temperature.

The backer rod shall be placed into the expansion joint gap at a minimum depth of 1 inch. Pour the BJB binder into the bridge joint gap, overfilling the joint gap to allow the binder to be spread onto the joint table. The binder will form a bond breaker between the joint table and the bridging plate.

The bridging plate shall be centered and placed over the entire length of the expansion joint gap. The plate shall be secured by placing spikes through the predrilled holes into the expansion joint gap backer rod. Do not overlap the bridging plate sections.

The blockout area shall be coated on the horizontal, vertical, and bridging plate surfaces with BJB binder to form a monolithic waterproof membrane.

The specified aggregate shall be heated to 250° F to 300° F in a rotating drum mixer. The temperature of the aggregate shall be controlled by using a hand held, calibrated, digital temperature sensor. Blend the binder into the aggregate at a ratio of 74% aggregate, to 26% binder, plus or minus 2% by weight. The specified aggregate must be totally precoated prior to installation.

The Koch BJS system is a three layered installation using the specified aggregate, precoated with binder. Layers one and two (from bottom to top) are 3/4 inch aggregate and layer three is 1/2 inch aggregate. When the final 1/2 inch aggregate layer is installed, the surface shall be left high enough above the existing pavement to allow for compaction (approximately 1/2 inch). Using a 2 ton roller, or larger, compact the aggregate layers perpendicular to the joint. The three layers form an interlocking joint matrix.

The compacted joint surface must be heated with a heat lance to a tack consistancy. Install a final thin membrane of binder followed immediately by an application of dry aggregate or sand. The joint will be ready for traffic 15 minutes after completion.

MEASUREMENT

Measurement for pay purposes will be based on the lineal feet of installed Koch BJS joint system, measured horizontally along the center line of the installed joint. Payment will include labor, materials, and all specialized equipment necessary to install the system.

Traffic control, unless otherwise stated, will be the responsibility of the client.